

Estimate

01/01/2012 AT 03:18 PM
12456

01234567890101-01
1YYY1ZZZ

GEICO
GEICO DIRECT
E-MAIL SUPPLEMENTS TO GASUPP@GEICO.COM
"VIST US AT GEICO.COM"
ONE GEICO CENTER
MACON, GA 31296

SUPPLEMENT OF RECORD 1 WITH SUMMARY

WRITTEN BY: ADJUSTER NAME 01/01/2012 03:15 PM
ADJUSTER: A000

INSURED: JOHN Q PUBLIC
OWNER: JOHN Q PUBLIC
ADDRESS: 2500 MAIN STREET
ATLANTA, GA 30062
BUSINESS: (770)678-4045
EVENING: (404)770-6789

CLAIM #01234567890101-01
POLICY #123456789
DATE OF LOSS: 01/01/2012 AT 04:00 AM
TYPE OF LOSS: UCOLLISION
POINT OF IMPACT: 8. LEFT QTR POST

INSPECT BODY SHOP
LOCATION: 123 MAIN RD W
MARIETTA, GA 30008

DAY: (770)678-4045X0000
DRIVE_IN

REPAIR FACILITY: FAST COLLISION

12 DAYS TO REPAIR

2009 BMW 330I 6-3.0L-FI 4D SED BLUE INT:

VIN: WBAVB33549123456789 LIC: ABC123 YMY GA PROD DATE: ODOMETER: 25,123

AIR CONDITIONING	REAR DEFOGGER	TILT WHEEL
CRUISE CONTROL	TELESCOPIC WHEEL	INTERMITTENT WIPERS
KEYLESS ENTRY	STEERING WHEEL CONTROLS	WOOD INTERIOR TRIM
DUAL MIRRORS	ELECTRIC GLASS SUNROOF	TRACTION CONTROL
STABILITY CONTROL	FOG LAMPS	XENON HEADLAMPS
CLEAR COAT PAINT	POWER STEERING	POWER BRAKES
POWER WINDOWS	POWER LOCKS	POWER DRIVER SEAT
POWER PASSENGER SEAT	POWER MIRRORS	HEATED MIRRORS
POWER TRUNK/GATE RELEASE	MEMORY PACKAGE	AM RADIO
FM RADIO	STEREO	SEARCH/SEEK
CD PLAYER	ANTI-LOCK BRAKES (4)	DRIVER AIR BAG
PASSENGER AIR BAG	HEAD/CURTAIN AIR BAGS	FRONT SIDE IMPACT AIR BAG
4 WHEEL DISC BRAKES	CLOTH SEATS	BUCKET SEATS
6 SPEED TRANSMISSION	ALUMINUM/ALLOY WHEELS	

NO.	OP.	DESCRIPTION	QTY	EXT.	PRICE	LABOR	PAINT
1		REAR BUMPER					
2	S01	O/H REAR BUMPER				2.2	
3	R&I	R&I BUMPER COVER				INCL.	
N 4*	S01 RPR	BUMPER COVER W/O PARK SENSOR, W/O TURBO SEDAN				3.5*	2.0*
5*	S01	ADD FOR CLEAR COAT					1.1*
6	S01 R&I	RT VENT COVER				INCL.	

Estimate

01/01/2012 AT 03:18 PM
12456

01234567890101-01
1YYY1ZZZ

SUPPLEMENT OF RECORD 1 WITH SUMMARY
2009 BMW 330I 6-3.0L-FI 4D SED BLUE INT:

NO.	OP.	DESCRIPTION	QTY	EXT.	PRICE	LABOR	PAINT
7	S01	R&I LT VENT COVER				INCL.	
8	S01	R&I CENTER SUPPORT SEDAN				INCL.	
9	S01	R&I LT OUTER SUPPORT SEDAN				INCL.	
10	S01	R&I RT OUTER SUPPORT SEDAN				INCL.	
11		REAR LAMPS					
12		R&I LT TAIL LAMP				0.4	
13	S01	R&I RT TAIL LAMP				0.4	
14		QUARTER PANEL					
N 15*	S01	RPR LT QUARTER PANEL				10.0*	2.0*
16*		ADD FOR CLEAR COAT					0.9*
17		ADD FOR LOCK PILLAR					0.5
18	S01	R&I LT SPLASH SHIELD				0.3	
N 19*	S01	RPR LT OUTER WHEELHOUSE				S 3.0*	0.3*
20		REAR DOOR					
N 21	S01	REPL LT DOOR SHELL	1	618.71		6.4	2.9
22	S01	OVERLAP MAJOR ADJ. PANEL					-0.4
23	S01	ADD FOR CLEAR COAT					0.5
N 24	S01	REPL LT BELT MOLDING W/HIGH GLOSS	1	62.98		INCL.	
25		R&I LT HANDLE, OUTSIDE BLACK				INCL.	
26		R&I LT R&I TRIM PANEL				INCL.	
27	S01	REPL LT SEAL	1	11.47		INCL.	
28	S01	R&I LT FIXED GLASS BMW				INCL.	
29	S01	R&I LT MOVEABLE GLASS BMW W/SUNSHADE				INCL.	
N 30	S01	REPL LT SURROUND W'STRIP	1	87.03		INCL.	
31		FRONT DOOR					
N 32*	S01	RPR LT DOOR SHELL				8.0*	2.0
33		OVERLAP MAJOR ADJ. PANEL					-0.4
34		ADD FOR CLEAR COAT					0.3
35		R&I LT R&I MIRROR AS AN ASSY				0.3	
36		R&I LT HANDLE, OUTSIDE W/KEYLESS ENTR				0.4	
37		R&I LT R&I TRIM PANEL				0.6	
38#		COVER/BAG VEHICLE FOR OVERSPRAY	1				0.2
39#	S01	REPL URETHANE GLASS KIT	1	15.00	T		
N 40	S01	REPL LT BELT MOLDING W/HIGH GLOSS	1	62.98		0.3	
41	S01	ROOF					
42	S01	R&I LT ROOF MOLDING				0.5	
43	S01	PILLARS, ROCKER & FLOOR					
44	S01	R&I LT ROCKER MOLDING W/O SPORT PACK				0.4	
45#	S01	REPL MASK JAMBS	1	3.00		0.3	
N 46#	S01	RPR COLOR, SAND, AND BUFF				1.6	
47#	S01	RPR SET UP/TIE DOWN				1.0	
N 48#	S01	RPR ROUGH/BODY PULL				2.0	
49		OTHER CHARGES					
50#		E.P.C.	1	3.00			

01/01/2012 AT 03:18 PM
12456

Estimate

01234567890101-01
1YYY1ZZZ

SUPPLEMENT OF RECORD 1 WITH SUMMARY
2009 BMW 330I 6-3.0L-FI 4D SED BLUE INT:

NO.	OP.	DESCRIPTION	QTY	EXT.	PRICE	LABOR	PAINT	
SUBTOTALS ==>			864.17			41.6	11.9	
LINE 4	:	TIME IS TO REPAIR DENTS, CREASES, AND SCRATCHES/GOUGES ON THE LT SIDE. BLEND WITHIN PANEL, FULL CLEAR.						
LINE 15	:	ADDITIONAL LABOR TIME DUE TO CREASES AND BUCKLES THROUGHOUT. LABOR TIME AGREED WITH CURTIS AT MAGNUM.						
LINE 19	:	TIME IS TO REPAIR DENTS AND BENDS. PARTIAL PANEL REFINISH.						
LINE 21	:	LKQ SHELL IS NOT COST EFFECTIVE PER JIMMY AT MCDONOUGH, SHERRY AT LKQ, CHRIS AT WEAVERS, AND CAR-PART.COM SEARCH. DOOR IS TWISTED FROM IMPACT.						
LINE 24	:	BOWED AND WARPS WHEN REMOVED.						
LINE 30	:	TWO-SIDED TAPE. UNABLE TO REUSE.						
LINE 32	:	ADDITIONAL TIME IS TO REPIAR BUCKLES ON THE DOOR.						
LINE 40	:	BOWED AND WARPS WHEN REMOVED.						
LINE 46	:	NEEDED FOR PROPER REFINISH OF THE LT FRONT DOOR, LT REAR DOOR, LT QTR PANEL, AND REAR BUMPER.						
LINE 48	:	TIME IS TO REPAIR MASH AND SWAY FROM IMPACT.						

ESTIMATE NOTES:
TOW/NO

RENTAL/NOT AVA

LKQ/CARPARTS

AM/KEYSTONE,HAYES

CHK TO PH

PRIOR DAMAGE NOTES:

MINOR SCRATCHES ON REAR COVER, MINOR DOOR DINGS, MINOR ROCK CHIPS FRONT COVER HOOD

PARTS					846.00
BODY LABOR	41.6	HRS	@ \$ 40.00/HR		1664.00
PAINT LABOR	11.9	HRS	@ \$ 40.00/HR		476.00
PAINT SUPPLIES	11.9	HRS	@ \$ 26.00/HR		309.40
SUBLET/MISC.					15.00
OTHER CHARGES					3.00
SUBTOTAL					\$ 3313.40
SALES TAX	TIER 1	\$ 1172.00	@ 6.0000%		70.00
TOTAL COST OF REPAIRS					\$ 3383.40

ADJUSTMENTS:
DEDUCTIBLE 100.00

TOTAL ADJUSTMENTS \$ 100.00
NET COST OF REPAIRS \$ 3283.40

Estimate